


GE Renewal Parts


Use original equipment parts for reliability


PARTS BULLETIN


DRILLING MOTOR MODEL 5GE752ARB1B
SEPTEMBER 9, 1992


[©] Copyright 1992 General Electric Company. All rights reserved. This copyrighted document may be reproduced free of charge by General Electric Company customers, if such reproduction is used exclusively in that customer's internal operation.

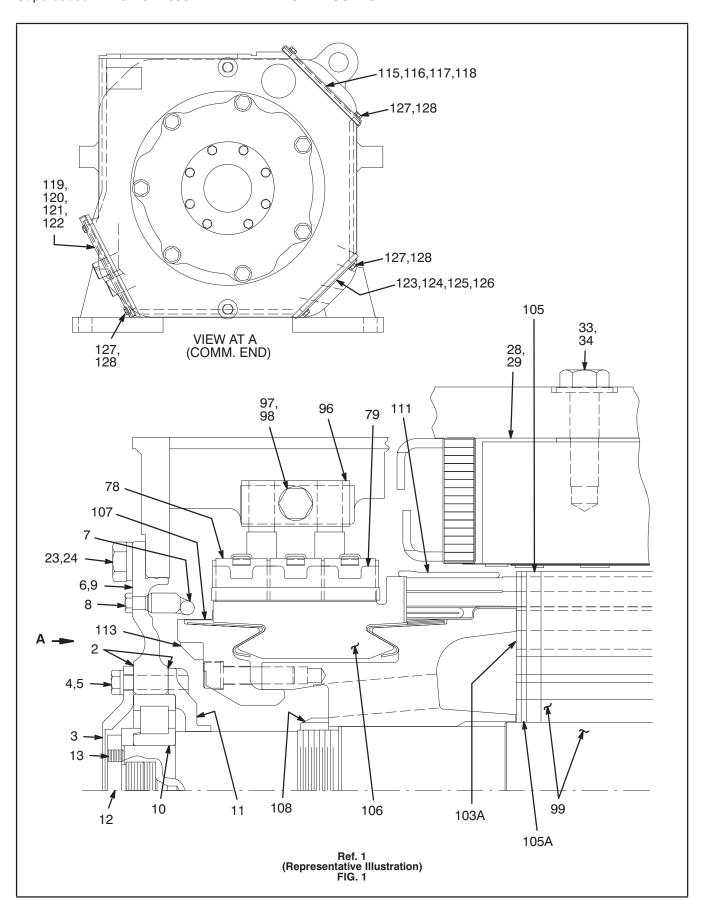

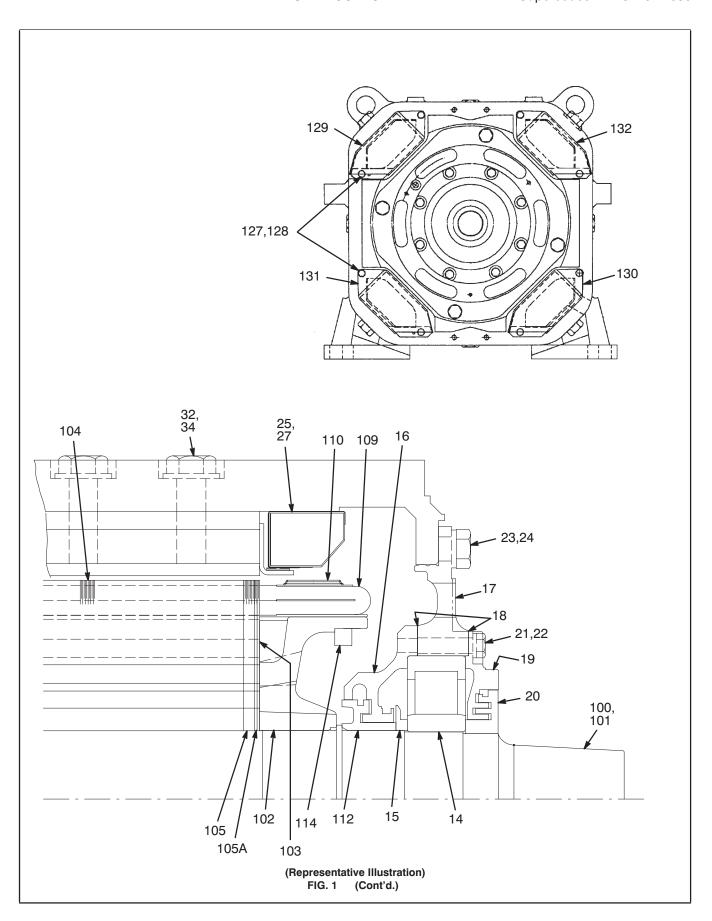

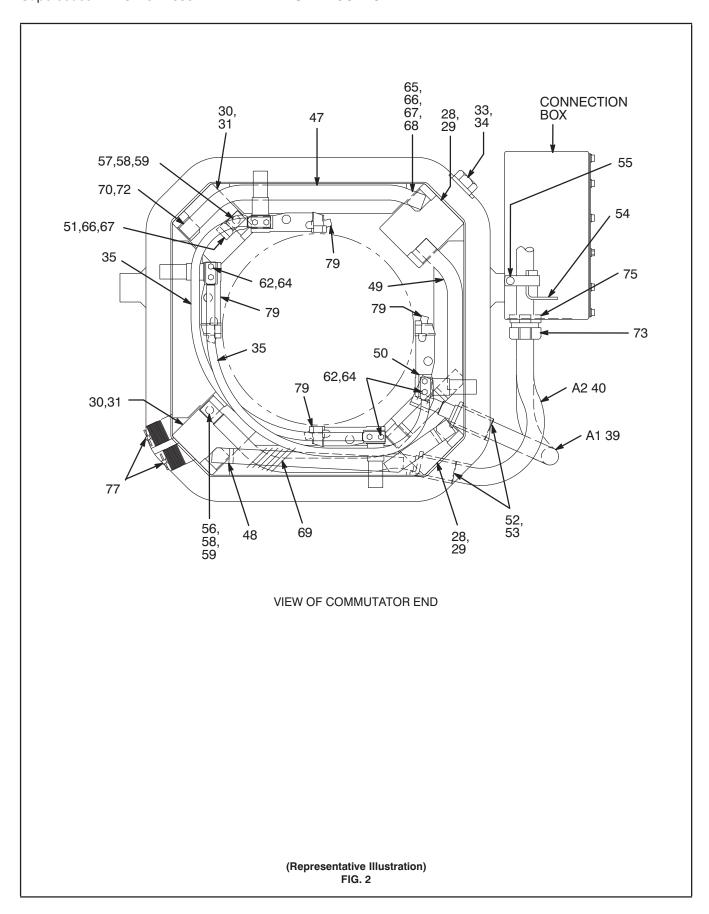

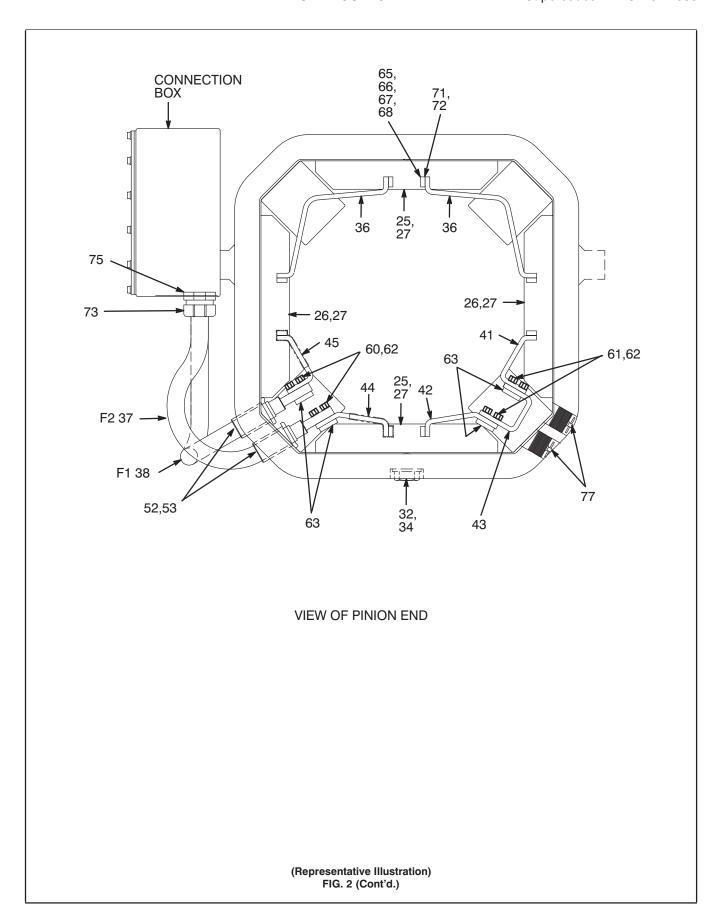

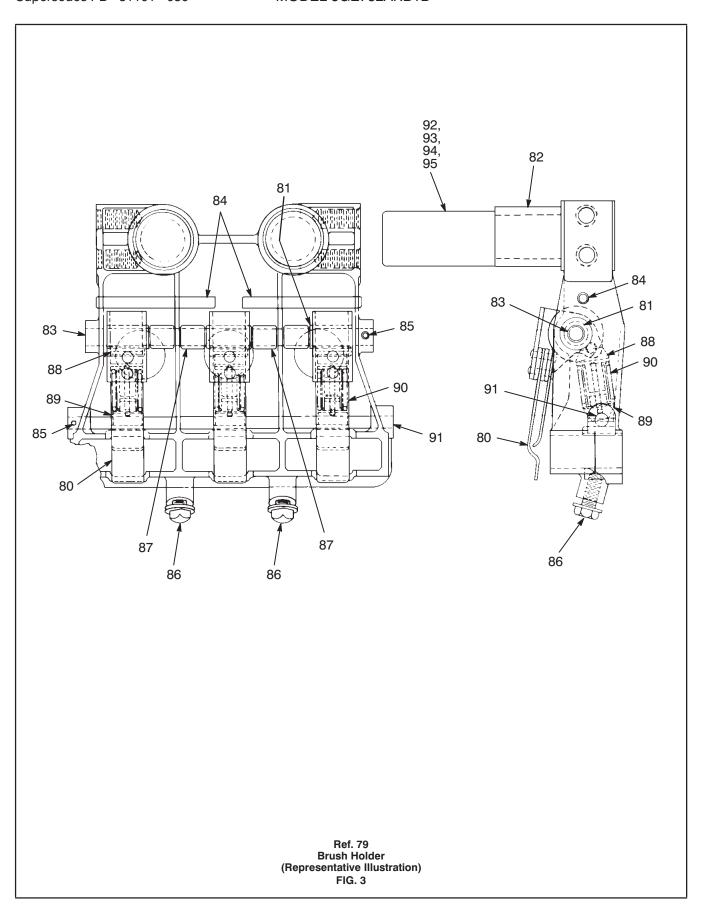

FIC	DEE		QUANT REQ.	
FIG. NO.	REF. NO.	PART NO.	COL. A	DESCRIPTION
1	1	5GE752ARB1B	1	DRILLING MOTOR
1	2	4732368P1	2	+GASKET, 0.021 IN THK
L	3	6739891P1	1	BEARING CAP
L	4	N22P33048	8	BOLT, HEX HD, 5/8 IN-11, 3 IN LONG
L	5	41B537660P9	8	WASHER, FLAT, 0.725 IN ID, 1 IN OD
L	6	9949565G1	1	FRAME HEAD ASSEMBLY
L	7	481A560G1	1	FLASH RING
L	8	N22P29020B13	6	BOLT, HEX HD, 1/2 IN-13, 1 1/4 IN LONG
L	9	N509P2516	1	PIN, SPRING DOWEL, 1/4 IN DIA, 1 IN LONG
1	10	8864951P119	1	+ROLLER BEARING
l	11	334B761P1	1	BEARING CAP
l	12	949X47	1	RETAINING NUT WITH SET SCREW
1	13	41A239107P1	2	SCREW, HEX SOC HD, 1/2 IN-13, 3/4 IN LONG
1	14	8864951P167	1	+ROLLER BEARING
1	15	4713640P1	1	FLINGER
l	16	6744700P2	1	BEARING CAP, INNER
l	17	41C637314P1	1	*FRAME HEAD
L	18	4732906P1	2	+GASKET, 0.021 IN THICK
L	19	2739317P1	1	BEARING CAP
l	20	4732351P1	1	SLEEVE
1	21	N22P33056	8	BOLT, HEX HD, 5/8 IN-11, 3 1/2 IN LONG
1	22	41B537660P9	8	WASHER, FLAT, 0.725 IN ID, 1 IN OD
1	23	N22P39032	11	BOLT, HEX HD, 1 IN-8, 2 IN LONG
1	24	41B537660P21	11	WASHER, FLAT, 1.063 IN ID, 2 IN OD
1,2	25	41E903691G7	2	*EXCITING COIL
2	26	41E903691G8	2	*EXCITING COIL
1,2	27	41B537112G2	4	POLE PIECE, EXCITING COIL
1,2	28	41C637285G7	2	COIL WITH POLE PIECE, COMMUTATING
1,2	29	41C637285G8	2	COIL, COMMUTATING
2	30	41C637285G10	2	*COIL WITH POLE PIECE, COMMUTATING
2	31	41C637285G11	2	*COIL, COMMUTATING
1,2	32	N22P45060	12	BOLT, HEX HD, 1 1/4 IN-7, 3 3/4 IN LONG
1,2	33	41A239559P1	12	BOLT, HEX HD, 1 1/4 IN-12, 4 IN LONG
1,2	34	41B537660P22	24	WASHER, FLAT, 1.453 IN ID, 2.500 IN OD
2	35	41C636243G2	2	CABLE ASSEMBLY
2	36	41C636867G3	2	#CONNECTION STRAP
2	37	41C637268G1	1	CABLE ASSEMBLY
2	38	41C637268G2	1	CABLE ASSEMBLY
2	39	41D735504G2	1	CABLE ASSEMBLY
2	40	41D735504G4	1	CABLE ASSEMBLY

^{*} ADDED OR CHANGED SINCE LAST ISSUE.

[#] WELD OR BRAZE IN POSITION.

⁺ RECOMMEND CUSTOMER STOCK THIS PART.

FIG.	REF.		QUANT REQ. COL.	
NO.	NO.	PART NO.	A A	DESCRIPTION
2	41	41C637269G2	1	#CONNECTION STRAP
2	42	41C637269G1	1	#CONNECTION STRAP
2	43	41C637269P1	1	CONNECTION STRAP
2	44	41C637269G3	1	CONNECTION STRAP
2	45	41C637269G4	1	CONNECTION STRAP
		DELETED	8	NOT USED
2	47	41C637261G1	1	CONNECTION STRAP, INSULATED
2	48	41C637261G5	1	CONNECTION STRAP, INSULATED
2	49	41C637261G2	1	CONNECTION STRAP, INSULATED
2	50	41C637261P4	1	CONNECTION STRAP, L-SHAPED
2	51	41D735504G7	1	SHUNT ASSEMBLY
2	52	481A539P20	4	CABLE BUSHING, 1 1/2 IN ID, RUBBER
2	53	41A216775P1	AR	+SEALANT, 1/8 BY 3 3/4 IN, 10 FT ROLL
2	54	41A237748G1	2	GROUND STRAP
2	55	41A235215P1	2	HOSE CLAMP, 0.75 IN TO 1.75 IN ID
2	56	N22P33028	1	BOLT, HEX HD, 5/8 IN-11, 1 3/4 IN LONG
2	57	N22P33024	1	BOLT, HEX HD, 5/8 IN-11, 1 1/2 IN LONG
2	58	N405P47B13	2	LOCKWASHER, 5/8 IN
2	59	N213P33	2	NUT, HEX, JAM, 5/8 IN-11
2	60	N22P27028B13	6	BOLT, HEX HD, 7/16 IN-14, 1 3/4 IN LONG
2	61	N22P27024B13	4	BOLT, HEX HD, 7/16 IN-14, 1 1/2 IN LONG
2	62	N405P44B13	20	LOCKWASHER, 7/16 IN
2	63	4713845P1	3	*BOLTING PLATE
2	64	N22P27020B13	10	BOLT, HEX HD, 7/16 IN-14, 1 1/4 IN LONG
2	65	41A239176P443	AR	SILASTIC PUTTY
2	66	41A239176P133	AR	SILICONE TAPE, 0.015 IN THICK, 1 IN WIDE
2	67	41A239176P22	AR	GLASS TAPE, 0.007 IN THICK, 1 IN WIDE
2	68	41A239176P487	AR	VARNISH
2	69	41A239176P399	AR	CORD
2	70	41A231281P47	7	BRAZING STRIP
2	71	41A231281P46	8	BRAZING STRIP, 1 IN X 1 IN LONG
2	72	41A330300P2	AR	BRAZING ALLOY, 0.050 X 0.062 IN
2	73	499A918DBP20	4	CONNECTOR, 1.375 TO 1.625 IN DIA CABLE
		499A904CYP3	1	BUSHING, REDUCING, 3/4 IN X 1/4 IN
2	75	41A306142P5	4	LOCKNUT W/WATER TIGHT SEAL, 1 1/2 IN CONDUIT
		N5700P63	4	PIPE PLUG, 3/4 IN, CSK SQ HD
2	77	41A239663P2	4	PLUG
1	78	41B537963P1	12	*+CARBON BRUSH
1,2,3	79	41C632667G6	4	+BRUSH HOLDER ASSEMBLY
3	80	41B530659G2	12	PRESSURE ARM

^{*} ADDED OR CHANGED SINCE LAST ISSUE.

[#] WELD OR BRAZE IN POSITION.

⁺ RECOMMEND CUSTOMER STOCK THIS PART.

			QUANT REQ.	
FIG. NO.	REF. NO.	PART NO.	COL. A	DESCRIPTION
3	81	41A231370P2	12	BUSHING, 1.063 IN LONG
3	82	186V831P1	8	SLEEVE
3	83	41A231378P2	4	PIN, 3/8 IN DIA, 6 5/8 IN LONG
3	84	N509P2548	8	PIN, SPRING DOWEL, 1/4 IN DIA, 3 IN LONG
3	85	N509P912	8	PIN, SPRING DOWEL, 3/32 IN DIA, 3/4 IN LONG
3	86	41A230733P7	8	BOLT W/WASHER, HEX HD SL, 5/16 IN-18, 3/4 IN LONG
3	87	41A231370P6	16	BUSHING, 0.575 IN LONG
3	88	41A330248P1	12	SPRING SEAT
3	89	41A233867G4	12	SPRING SEAT WITH PIN
3	90	41B537844G1	12	SPRING SET ASSEMBLY
3	91	41A233880P1	4	PIN, 7 7/16 IN LONG
3	92	41B535754G28	8	BRUSH HOLDER STUD, MOLDED (0.002 IN OVERSIZE)
3	93	41B535754G29	8	BRUSH HOLDER STUD, MOLDED (0.004 IN OVERSIZE)
3	94	41B535754G30	8	BRUSH HOLDER STUD, MOLDED (0.006 IN OVERSIZE)
3	95	41B535754G31	8	BRUSH HOLDER STUD, MOLDED (0.008 IN OVERSIZE)
L	96	2733755P7	4	SUPPORT, BRUSH HOLDER
L	97	N22P37052	4	BOLT, HEX HD, 7/8 IN-9, 3 1/4 IN LONG
l	98	41B537660P25	4	WASHER, FLAT, 0.968 IN ID, 1.375 IN OD
1	99	41D735773G1	1	*ARMATURE ASSEMBLY
1	100	41C636928G1	1	SHAFT WITH PLUG
1	101	8819420P1	2	PLUG, HEX SOC HD, 3/8 IN-24, 1 IN LONG
1	102	41B537605P4	1	*ARMATURE HEAD
1	103	41A239323G1	1	*PUNCHING, END
1	103A	41A330418G1	1	*PUNCHING, END
1	104	41B537164P1	553	PUNCHING, MAIN
1	105	41B537165P1	26	*PUNCHING, STEP BACK
1	105A	41B537165P2	14	*PUNCHING, STEP BACK
1	106	41B537889G2	1	COMMUTATOR, SEASONED
1	107	41B537080P1	1	* =TEFLON BAND (CONTINUOUS)
1	108	189V584P1	1	NUT
1	109	41D735370G5	1	*+REWIND KIT
1	110	41A330208P10	AR	WIRE, 0.072 IN DIA
1	111	41A239176P64	AR	GLASS TAPE, 0.014 IN THICK, 3/4 IN WIDE
1	112	41A232821P1	1	SLEEVE
1	113	2766829ADP24	AR	#BALANCE WEIGHT, 13 IN OD
1	114	2766829ADP26	AR	#BALANCE WEIGHT, 14 3/4 IN OD
1	115	41C636513G1	1	INSPECTION COVER, UPPER
1	116	41C636513P11	2	+GASKET, 9 3/4 IN LONG
1	117	41C636513P12	2	+GASKET, 11 1/4 IN LONG

^{*} ADDED OR CHANGED SINCE LAST ISSUE.

[#] WELD OR BRAZE IN POSITION.

⁺ RECOMMEND CUSTOMER STOCK THIS PART.

⁼ ADDITIONAL MATERIAL IS REQUIRED TO INSTALL THE CONTINUOUS LOOP TEFLON BAND. SEE APPLICATION INSTRUCTIONS, GEK-76278.

FIG. NO.	REF. NO.	PART NO.	QUANT REQ. COL. A	DESCRIPTION
1	118	497A806P12	AR	+CEMENT
1	119	41D732878G4	1	INSPECTION COVER, LOWER
1	120	41D732878P7	2	+GASKET, 11 9/32 IN LONG
1	121	41D732878P8	2	+GASKET, 9 1/2 IN LONG
1	122	497A806P12	AR	+CEMENT
1	123	41A239914G1	1	INSPECTION COVER, HAND HOLE
1	124	41A239914P2	2	GASKET, NEOPRENE, 0.250 X 0.560 X 9.250 IN LONG
1	125	41A239914P3	2	GASKET, NEOPRENE, 0.250 X 0.560 X 8.120 IN LONG
1	126	497A806P12	AR	CEMENT
1	127	N22P29016B13	20	BOLT, HEX HD, 1/2 IN-13, 1 IN LONG
1	128	N405P45B13	20	LOCKWASHER, 1/2 IN
1	129	8855497P6	1	SPLASH GUARD
1	130	8855497P7	1	SPLASH GUARD
1	131	8855497P8	1	SPLASH GUARD
1	132	8855497P9	1	SPLASH GUARD
		41A237902P1	1	PLATE (WARNING - DO NOT OPEN WHILE -)

⁺ RECOMMEND CUSTOMER STOCK THIS PART.